

Date: Tuesday, 12/20/2005 3:33:25 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY RH
 Job Number : 25318
 Estimate Number : 10265
 P.O. Number : N/A Part Number : D350636012
 This Issue : 12/20/2005 S.O. No. : N/A Drawing Number : D2750 REV C1
 Prsht Rev. : NC Project Number : N/A
 First Issue : 12/20/2005 Type : LANDING GEAR Drawing Revision : C1
 Previous Run : 25317 Material : N/A
 Due Date : 1/20/2006 Qty: 1 Um: Each
 Written By : SEE COMMENT BELOW
 Checked & Approved By : SEE ABOVE DATE & USER
 Comment : Est Rev: 02.09.25 Rearranged procedure steps KJ

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 001

①
 NH 06/01/13

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-3-Bent Extrusion (Bent)

B25384 Pm 06-02-06 ①

PTO

3.0 D2744 Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2744 Cap

B23098 3E 06-02-08 ①

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut D2600-3-Bent aft end to length as per Dwg D2750 Mark cut line using Jig DT 8150. Deburr end

Pm 06-02-06 ①

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1) and mark fwd end for cutting using Drill Jig DT 8150. Second side of Detail B to be Drilled using DT 8330

Pm 06-02-07 ①

3-Open up holes for Detail B, D and 2 aft 0.500" AE holes to finished size as per Dwg D2750 and DEO 9133 Do not open any 0.625" AE holes to finished size

Pm 06-02-07 ①

4-Drill pilot holes as per Dwg D2750 (Sheet 3, D2750-2), mark Fwd end for cutting using Drill Jig

Pm 06-02-07 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ ☐ Date: 06/02/06
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06-02-06	2	DT8329 doesn't fit onto extrusion. extrusion to anal.	<i>[Signature]</i> 06-02-06	Scrap & replace tube. mat'l already under investig- ation by QC and supplier	<i>[Signature]</i> 06-02-06	<i>[Signature]</i> 06-02-06	<i>[Signature]</i> 06-02-06	<i>[Signature]</i> 06-02-06
06-02-07	4	4 wearplate holes drilled on top of tube at the aft end. Size #30	<i>[Signature]</i> 06-02-07	Fill holes with weld as per QSI 014 and grind flush. ensure employee knows top from bottom.	<i>[Signature]</i> 06-02-15	<i>[Signature]</i> 06-02-15	<i>[Signature]</i> 06-02-07	<i>[Signature]</i> 06-02-07

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #: Machine Or Operation: Description :

DT8150, then drill both sides.

5-Open holes as per detail "P" To 500", then Drill pilot holes to detail "B" using DT8329 *pm' 06-02-07 ①*
Make sure that wearplate holes are on bottom of tube**

6-Open holes to .500" as per detail "B&C". *pm' 06-02-07 ①*

7-Open holes to .375" as per detail "D" *pm' 06-02-07 ①*

8-Cut fwd end of tube as per Dwg D2750 *pm' 06-02-07 ①*

9-Drill pilot holes for wearplates using DT 8108 Open holes to 0.297" and Open holes per Dwg D2750 detail *pm' 06-02-07 ①*
A

10-Open holes to .590" as per detail "D". *pm' 06-02-07-①*

11-Deburr *pm' 06-02-07 ①*

12-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *m/9/00 BE 06-02-08 ①*

13-Grind welds flush as per Dwg D2750
BE 06-02-08 ①

5.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 *a.m 06-02-08 ①*

6.0 QC5/9

WELD INSPECTION



5/ PD 06-2-8 ①

PD 06-02-08



Comment: WELD INSPECTION

7.0 D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2739 Web *B25540*

pm' 06-02-09 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #: Machine Or Operation: Description :

8.0 D2743 Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Pick:

Qty Part Number Description Batch

8 D2743 Crossbolt spacer

B 24641 BE 06-02-10 (1)

9.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open 0.625" AE holes and countersink for welding crossbolt spacers as per Dwg D2750. Do not use cutting oil

pm 06-02-08 (1)

2-Deburr and blow out all chips from inside of tube

pm 06-02-08 (1)

3-Bond web D2739 in place as per QSI 015

A/R Sikaflex-291

M19597

Sikaflex expire date: 06-06-18

pm 06-02-09 (1)

4-Weld crossbolt spacers D2743 as per Dwg D2750 and QSI 004

A/R Aluminum Rod

M19100 BE 06-02-10 (1)

5-Grind welds flush as per Dwg D2750

IT 06-02-13 (1) BE 06-02-13 (1)

6-Spot face ground handling holes AE0.750" (8 places)

IT 06-02-13 (1) BE 06-02-13 (1)

7-Deburr holes

IT 06-02-13 (1) BE 06-02-13 (1)

10.0 QC5/9 WELD INSPECTION



Comment: Inspect weld and work to Step 20.

PD 06-02-15

11.0 POWDER COATING POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

A.M 06-02-22 (1)

12.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

FL 06 02 22

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

13.0	D27422	Blade Fitting, RH
------	--------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2742-2	Blade Fitting, LH	024640

FC

14.0	AN835A	Bolt
------	--------	------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	AN8-35A	Bolt	18576

FC

15.0	AN960JD816	1/2" washer, Alum
------	------------	-------------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
2	AN960JD816	Washer	186956

FC

16.0	MS21083N8	Nut
------	-----------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	MS21083N8	Nut	18185

FC

17.0	D26483	Wearpad
------	--------	---------



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
5	D2648-3	Wearpad	239780

FC

18.0	D265613	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-13	Wearplate	0241147

FC

06 02 22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

19.0	D265635	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-35	Wearplate	624148

FC

20.0	D2746	Wearshoe
------	-------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2746	Wearplate	B 241149

FC

21.0	ALS41032225	Insert
------	-------------	--------



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
46	ALS4-1032-225	Insert	m14576
	(or AKS4-1032-225)		
	(or ALS7-1032-225)		
	(or AKS7-1032-225)		

FC

22.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
42	AN960JD10L	Washer	m14185

FC

23.0	AN35A	Bolt
------	-------	------



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
38	AN3-5A	Bolt	m14526

FC

06 02 22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

24.0	AN36A	Bolt
------	-------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
4	AN3-6A	Bolt	m19185

FC

25.0	D2745	Bushing
------	-------	---------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
8	D2745	Bushing	B24146

FC

26.0	AN644A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
4	AN6-44A	Bolt	m18949

FC

27.0	MS21042L6	Nut
------	-----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
4	MS21042L6	Nut (or -6)	m17614

FC

28.0	AN332A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
4	AN3-32A	Bolt	m18906

FC 06 02 22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #: Machine Or Operation: Description :

29.0 A3235020935 Washer - Countersunk



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number Description Batch
8 A3235-020-935 Plug m18332

FC

30.0 MS21042L3 Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number Description Batch
4 MS21042L3 Nut m6031

FC

31.0 AN36A Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number Description Batch
4 AN3-6A Bolt m19185

FC

32.0 AN960JD10 Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number Description Batch
4 AN960JD10 Washer m16066

FC

33.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Assemble as per Dwg D2750 Page 4 Detail P. Install D2742-2 and seal with Sikaflex adhesive prior to installing aft most wearpad. Ensure holes are properly aligned.

A/R Sikaflex-291 m19597
Sikaflex expire date: 06 18 06

FC

2-Install inserts & wearplates as per Dwg. D2750 Detail K & Q and IIN-D350-636 Page 4. Use a drop of Sikaflex in insert holes before installing wearpad/wearplate. AN3-6A bolts are installed AFT.

A/R Sikaflex-291 m19597
Sikaflex expire date: 06 18 06

FC 06 02 22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #: Machine Or Operation: Description :

3-Install D2745 Bushing as per Dwg. D2750 Detail M

FC

4-Install A3235-020-935 Plug as per Dwg. D2750 Detail L

FC

06 02 22

5-Install AN3-6A Bolt as per Dwg. D2750 Detail Q

FC

34.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

M 06 02 23

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

36.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Kit Picking

Qty Part Number

Description

Batch

1 D2741

Blade

B27595B

37.0

AN960JD816

1/2" washer, Alum



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Kit Picking

Qty Part Number

Description

Batch

2 AN960JD816

Washer

M6956

38.0

MS21083N8

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Kit Picking

Qty Part Number

Description

Batch

2 MS21083N8

Nut

M19089

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/20/2005 3:33:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 25318

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

39.0	AN816A	Bolt
------	--------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Kit Picking

Qty Part Number

Description

Batch

2 AN8-16A

Bolt

M6950

P06/2/23 (1)

40.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

C206102127 (1)

41.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-012

REV.D

C206102127 (1)

42.0	DC	DOCUMENT CONTROL
------	----	------------------



Comment: DOCUMENT CONTROL

Inspection Level 21

D06/02/08 (1)

Job Completion



U 060228

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE USA, INC. BELLEVUE, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2750	REV. C SHEET 1 OF 4
DATE 98.11.18		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
C1	<i>[Signature]</i> 95.01.20	CHANGE QTY WEARSHOE HOLES, AS MANUFACTURED	

RELEASED
98.12.16 DS

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
3	3	3	3	D2648-3	WEARPAD
2	2	2	2	D2648-5	WEARPAD
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
1		1		D2742-1	BLADE FITTING, LH
	1		1	D2742-2	BLADE FITTING, RH
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
8	8			A3235-020-935	PLUG
40	40	40	40	AN3-5A	BOLT
8	8	8	8	AN3-6A	BOLT
4	4			AN3-32A	BOLT
4	4	4	4	AN6-44A	BOLT
2	2	2	2	AN8-16A	BOLT
1	1	1	1	AN8-35A	BOLT
3	3	3	3	MS21083N8	NUT
4	4			MS21042L3 OR MS21042-3	NUT
4	4	4	4	MS21042L6 OR MS21042-6	NUT
4	4	4	4	AN960JD10	WASHER
44	44	44	44	AN960JD10L	WASHER
4	4	4	4	AN960JD816	WASHER
44	44	44	44	ALS4-1032-225 or AKS4-1032-225 or ALS7-1032-225 or AKS7-1032-225	INSERT

EFFECTIVE DEOS
D20 4133 DS
98.01.19 DS
D20 4137
98.10.21 DS

SUBJECT TO
WITH YOU



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE USA, INC. BELLEVUE, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2750	REV. C SHEET 2 OF 4
DATE 98.11.18		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS


GENERAL NOTES:

1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
3. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
4. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E AND F-F.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
7. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2734 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
8. INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4.
9. D2742-1 (OR D2742-2) BLADE FITTING AND AN3-5A/AN3-6A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.


EFFECTIVE	DEOs
DEO 9133 98.01.19 DS	DEO 9157 99.10.21 DS

RELEASED
98.12.16 DS

ORDER
25318


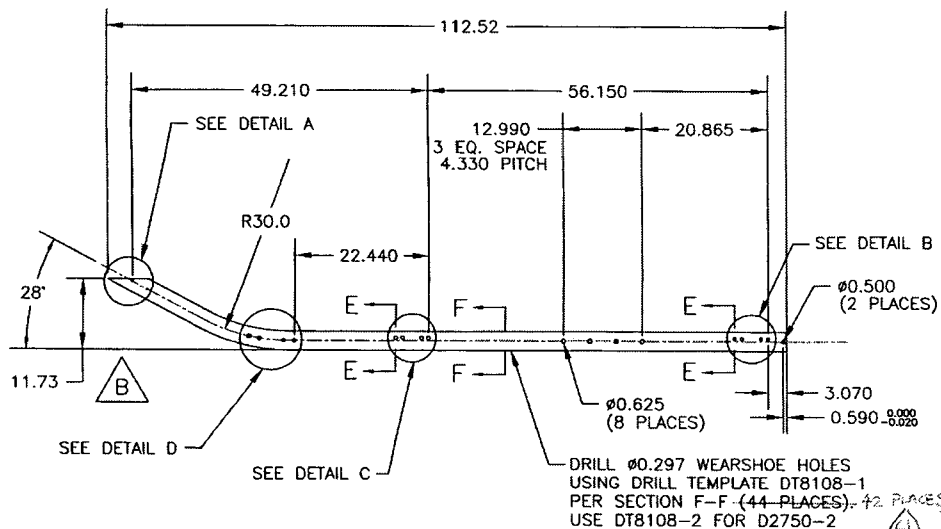


D2750-1 LH SKIDTUBE (SHOWN)
D2750-2 RH SKIDTUBE (OPPOSITE)

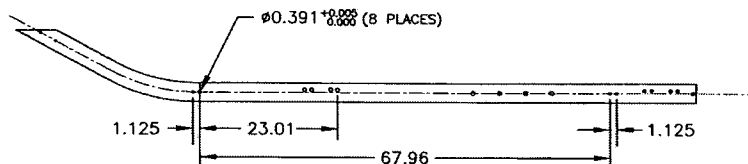


D2750-3 LH SKIDTUBE (SHOWN)
D2750-4 RH SKIDTUBE (OPPOSITE)

D2750-3/-4 ARE THE SAME AS D2750-1/-2 EXCEPT THAT DETAIL D HOLES
ARE REPLACED BY HOLE CONFIGURATION GIVEN ABOVE.

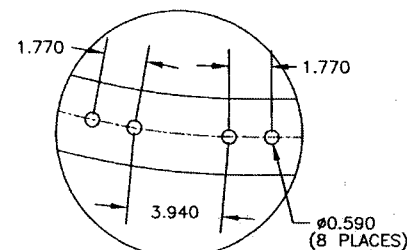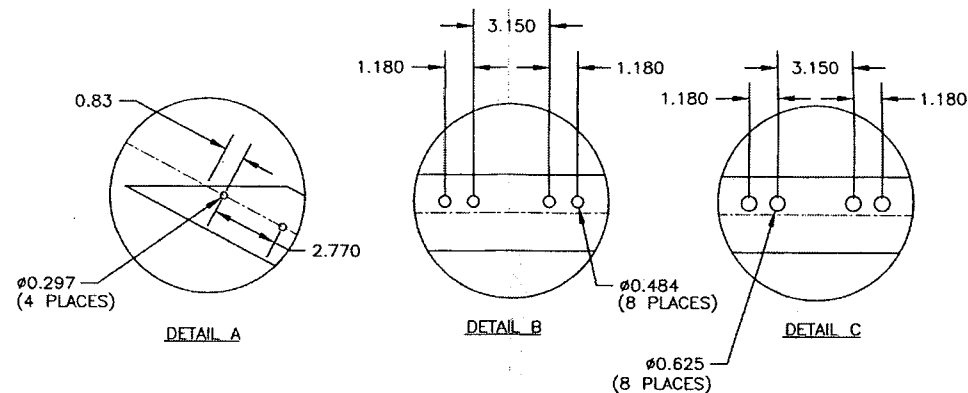

(ALL DIMENSIONS ARE
STRAIGHT LINE DIMENSIONS)

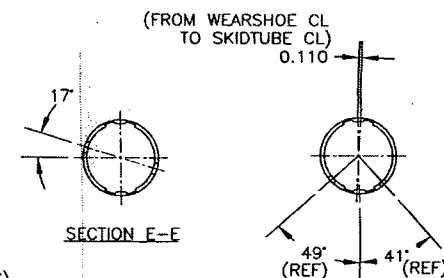


RELEASED
98.12.16 DS

EFFECTIVE	DEOS
DES 9133 98.01.19 DS	DES 9133 99.01.21 DS


DESIGN 98	DRAWN BY JP	DART DART AEROSPACE USA, INC. BELLINGHAM, WA
CHECKED JP	APPROVED KE	
DATE 98.11.18	DRAWING NO. D2750	REV. C SHEET 3 OF 4
	TITLE 350 SKIDTUBE ASSEMBLY	SCALE 1:20

25318


D2750-1/-2/-3/-4 WELDING DETAIL
(FLOAT ATTACHMENT HOLES REMOVED)
D2750-1/-3 SHOWN (D2750-2/-4 OPPOSITE)

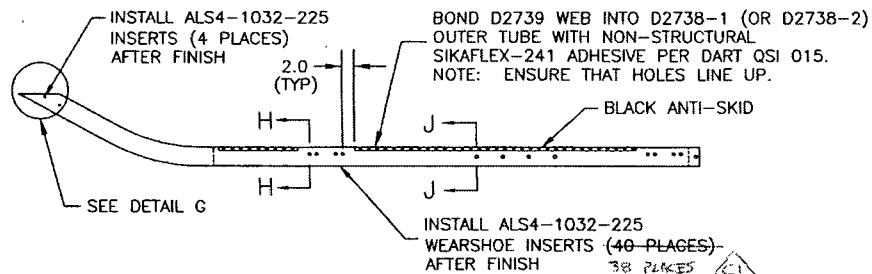


DETAIL G

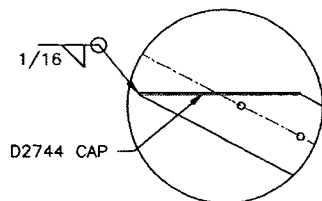

SECTION H-H

 


(TYP)

 

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

 
DETAIL K



USE AN3-6A BOLTS FOR INSTALLING AFT D2648-3 WEARPAD


AN3-5A BOLT (1)
AN960JD10L WASHER (1)
(44 PLACES)
(42 PLACES)

DETAIL M

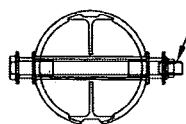


AN6-44A BOLT (1)
D2745 BUSHING (2)
MS21042L6 NUT (1)
(4 PLACES)

DETAIL P

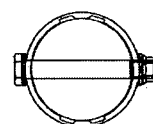


AN8-35A BOLT (1)
AN960JD816 WASHER (2)
MS21083N8 NUT (1)

DETAIL Q

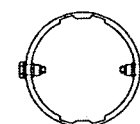


AN3-6A BOLT (1)
AN960JD10 WASHER (1)
(4 PLACES)

DETAIL L

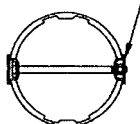


AN3-32A BOLT (1)
A3235-020-935 PLUG (2)
MS21042L3 NUT (1)
(4 PLACES, FOR D2750-041/-042 ONLY)

DETAIL N

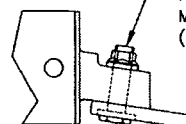


AN8-16A BOLT (1)
AN960JD816 WASHER (1)
MS21083N8 NUT (1)
(2 PLACES)

D2750-041/-042 ASSEMBLY
D2750-041 SHOWN (D2750-042 OPPOSITE)

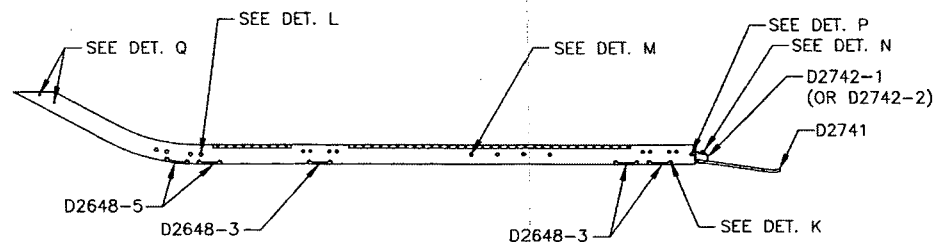

D2750-043/-044 ASSEMBLY
D2750-043 SHOWN (D2750-044 OPPOSITE)

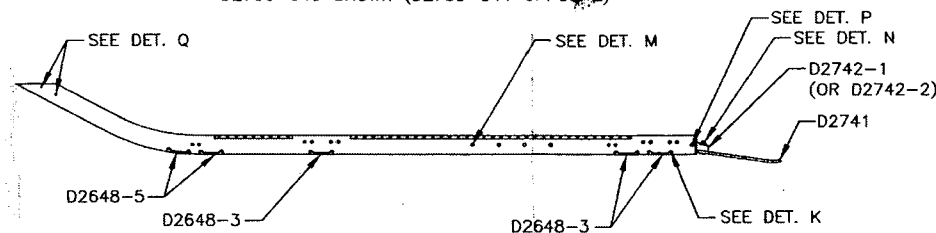

RELEASED
98.12.16 DS

EFFECTIVE	DEOs
180 9/33 98.01.19 DS	180 9/57 98.10.21 DS

DESIGN #	DRAWN BY CP	DART DART AEROSPACE USA, INC. BELLINGHAM, WA	REV. C
CHECKED #	APPROVED KE	DRAWING NO. D2750	SHEET 4 OF 4
DATE 98.11.18		TITLE 350 SKIDTUBE ASSEMBLY	SCALE 1:20


25318

COPY

NDMENT

ICE

D350-636-011/-012

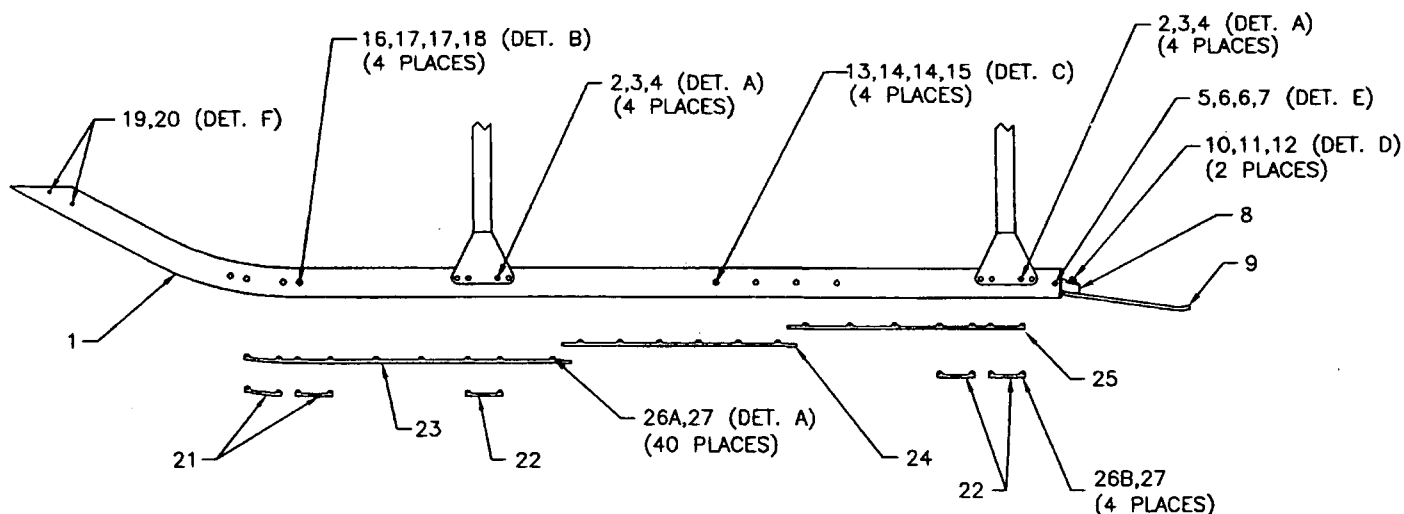

D350-636-013/-014

